

Manhole Inspection Summary

Manhole # S35M__025MH

Printed On: 1/29/2009

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **5) Immediate Attention Required**

Record Plat: **35M** Node: **025** Status: **Found**

Insp Date: **3/24/08 10:31 AM**

Incomplete Comments

Crew: **5**
Inspector: **jjoirer**
Firm: **ATS**

Location Address: **John L Deaton Pavillion**

Cross Street: **light st**

Manhole Type: **Terminal**

Location: **Sidewalk**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **Ponding**

Comments **Filled up with debris can not even see the top of any pipes. Suppose to be an out at 12 & a house connection at 5.**

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Cracked**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **1** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☐ Exists Material:

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Unknown**

☐ Parged

Channel Exposure: **Closed**

Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps

Count: **7** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge

Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S35M__025MH


Printed On: 1/29/2009

Page 2 of 3

Location View



Top View

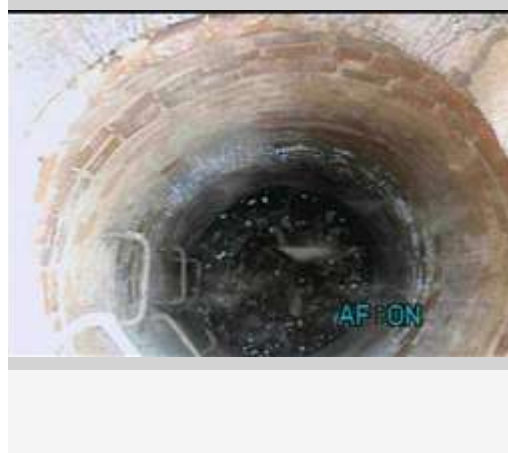

Defect 4



Channel debris at 5

Defect 3



corroded Steps

Defect 2



infiltration from cover

Defect 1



Cracked cover

Manhole Inspection Summary

Manhole # S35M__025MH

Printed On: 1/29/2009

Page 3 of 3

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: 0 (in.) Direct

Pipe Material: **Unknown** ☐ Pipe Lined

Invert Depth: 11.23 (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: 16 (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection